


Order Code	Description
<input checked="" type="checkbox"/> DPMS1	PosiTector Standard with DPM S Probe
<input type="checkbox"/> DPMS3	PosiTector Advanced with DPM S Probe

PosiTector DPM Dew Point Meter			Compare PosiTector Gage Bodies	
Features	Standard	Advanced		
Large 2.8" impact resistant color touchscreen with redesigned keypad for quick menu navigation	●	●		
Auto Log mode runs unattended on batteries for up to 50 hours or continuously via USB	●			
Enhanced Auto Log mode turns the gage off between readings for up to 8 months of battery life. Each reading can be uploaded to PosiSoft.net or an FTP server using WiFi. Automatically group readings into batches at daily, weekly, or monthly intervals.		●		
Two year warranty on body AND probe	●	●		
User defined limits for all parameters—visible and audible warnings. Send email alerts when connected to WiFi.		●		
Reading Storage Capacity	2,500 datasets	250,000 datasets in up to 1,000 batches		
Touchscreen keyboard for quickly renaming batches, adding notes, and more		●		
Store thickness, profile, environmental, salt contamination, hardness, and wall thickness measurements in individual batches		●		
Wet bulb temperature can be displayed and recorded		●		
Trend Charts graph readings in real-time		●		
Connection Options				
USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.	●	●		
WiFi technology wirelessly synchronizes with PosiSoft.net and downloads software updates		●		
Bluetooth 4.0 Technology for data transfer to a mobile device running the PosiTector App or optional portable printer. BLE API available for integration into third-party software.		●		



Removable Integral Probe with Cabled Surface Temperature Sensor

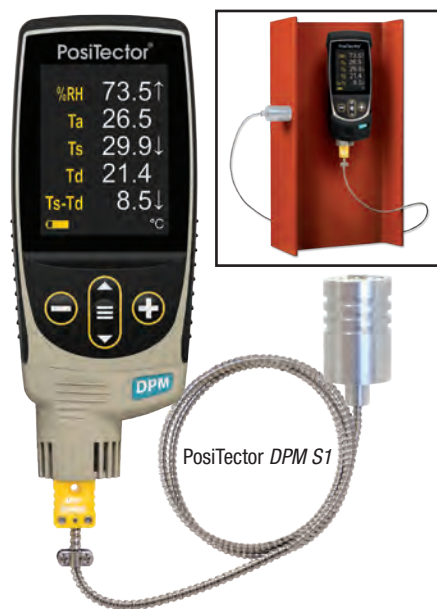

Probe Model DPM S

Surface Temperature	✓
Air Temperature	✓
Wet Bulb Temperature*	-
Relative Humidity	✓
Dew Point Temperature	✓
Surface Temperature minus Dew Point Temperature	✓
Wind Speed	-

*Wet Bulb Temperature displayed/recorded on PosiTector Advanced (3) models only

DPM S Probe measures and records climatic conditions including: Relative humidity, air temperature, surface temperature, dew point temperature, and difference between surface and dew point temperatures. Includes the ambient temperature and humidity sensors from PosiTector DPM Integral Probe plus a magnetic surface temperature sensor with armored cable (also accepts other optional K-type sensors).

Order Code	Description
<input checked="" type="checkbox"/> DPMS1	PosiTector Standard with DPM S Probe
<input type="checkbox"/> DPMS3	PosiTector Advanced with DPM S Probe

All Gages Feature...



Simple

- All readings are constantly updated and displayed simultaneously
- No need to consult complex tables or use a slide rule calculator
- Alarms indicate when climate conditions are unsuitable for painting
- Large 2.8" impact resistant color touchscreen with redesigned keypad for quick menu navigation
- On-gage help explains menu items at the touch of a button
- RESET feature instantly restores factory settings



Durable

- Weatherproof, dustproof, and water-resistant—IP65-rated enclosure
- Ergonomic design with durable rubberized grip
- Shock-absorbing protective rubber holster for added impact resistance
- Two year warranty on gage body AND probe



Accurate

- Fast response precision sensors provide accurate, repeatable readings
- SmartTrend™ Indicators identify rising, falling, or stable readings
- Certificate of Calibration showing traceability to NIST included (Long Form)
- Conforms to national and international standards including ISO and ASTM



Versatile

- Auto Log mode records environmental parameters at user selected time intervals
- Celsius/Fahrenheit switchable
- Selectable display languages
- Auto rotating display with Flip Lock



Powerful

- Hold function freezes the display allowing measurements to be manually recorded
- Screen Capture—save 100 screen images for record keeping and review
- Instant-on feature quickly powers up the gage if recently powered down
- Up to 30% longer battery life
- USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.
- Software updates via web keep your gage current
- Every stored measurement is date and time stamped
- Includes PosiSoft suite of software for viewing and reporting data (see page 3)

Specifications	Range	Accuracy	Resolution
Surface Temperature	-40° to 80° C	± 0.5° C	0.1° C
	80° to 190° C	± 1.5° C	
	-40° to 175° F	± 1° F	0.1° F
	175° to 375° F	± 3° F	
Air Temperature	-40° to 80° C	± 0.5° C	0.1° C
	-40° to 175° F	± 1° F	0.1° F
Humidity	0 to 100%	± 3%	0.1%
Dew Point	-60° to 80°C	± 3° C*	0.1° C
	-76° to 175° F	± 5.4° F*	0.1° F

*Dependent on RH. See www.defelsko.com/TdAccuracy for more information.



Comes complete with PosiTector gage body, DPM probe, environmental sensors, protective rubber holster, wrist strap, 3 AAA batteries, instructions, hard case (DPM/DPMA/DPMD), hard shell carrying case (DPMS), protective lens shield, Long Form Certificate of Calibration traceable to NIST, USB cable, two (2) year warranty.

***SIZE:** 127 x 66 x 25.4 mm (5" x 2.6" x 1")

***WEIGHT:** 137 g (4.9 oz.) without batteries

CONFORMS TO: ISO 8502-4, BS 7079-B4, ASTM D3276, IMO PSPC, SSPC-PA7, and US Navy NSI 009-32

*Size and weight are for the PosiTector gage body only and do not include the probe.